



# CABLE ASSEMBLY INSTRUCTIONS

RFD-43F-HPL

MAIN BODY

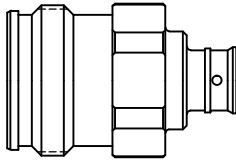

 PIN




SPACER




TUBING




STEP 1

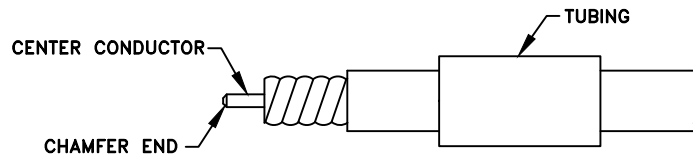


STEP 2

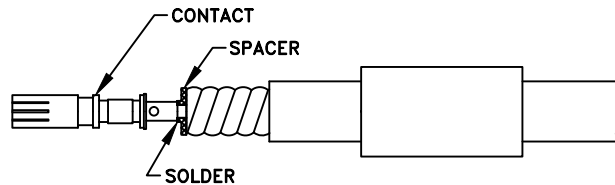

STEP 3

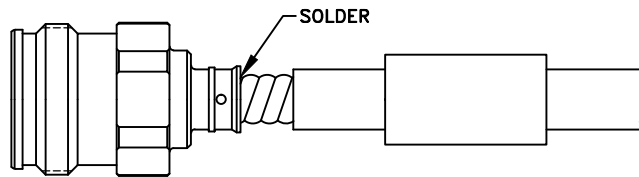

STEP 4

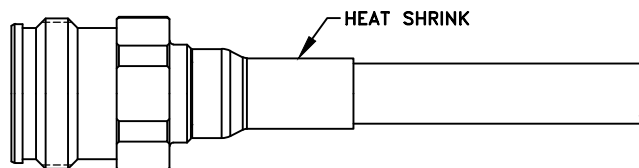

Step 1: Cut end of cable evenly. Strip cable to dimensions shown on connector outline drawing. All cuts are to be clean and square. Do not nick center conductor when cutting. Chamfer center conductor with a file to break sharp corners for smooth entry into rear contact. Slide heat shrink tubing onto cable.

Step 2: Slide spacer onto cable center conductor. Insert contact onto center conductor until it flush with spacer. Solder contact in place.

Step 3: Slide the cable assembly into the connector's rear body until it yields in place and solder.

Step 4: Slide the tubing until it yields against connector body and heat shrink in place.

RFD-43F-HPL AP.DWG

*RF CONNECTORS*

06/06/17

7610 Miramar Road, San Diego, CA 92126-4202 - (858) 549-6340  
(800) 233-1728 - Fax (858) 549-6345 E-mail: [rfi@rfindustries.com](mailto:rfi@rfindustries.com) - [www.rfindustries.com](http://www.rfindustries.com)

CZ