
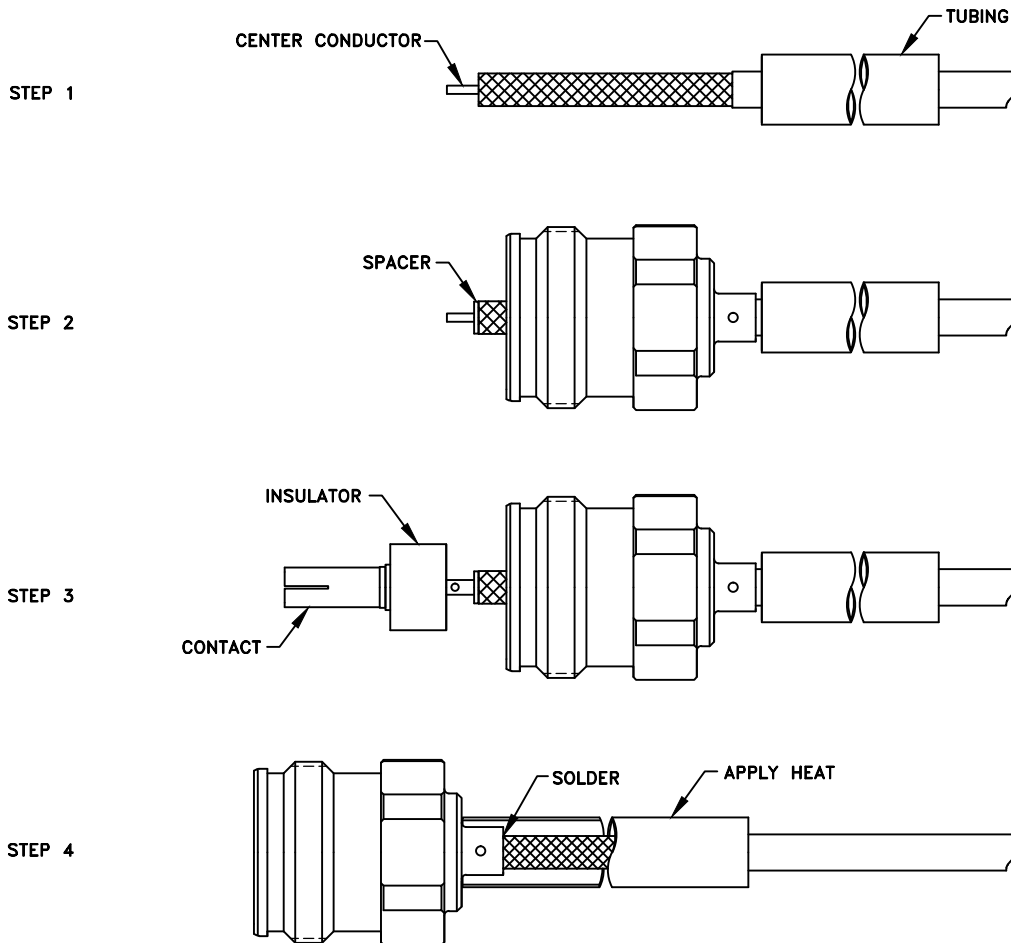


# CABLE ASSEMBLY INSTRUCTIONS

RFD-43F-SR2

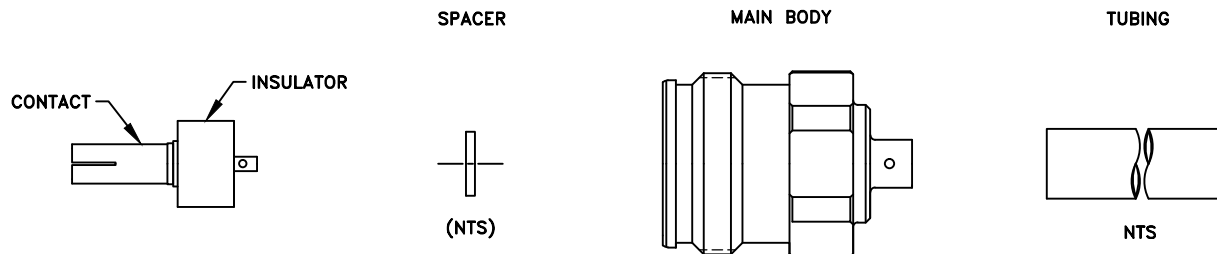

- Step 1:** Cut end of cable evenly. Strip cable to dimensions shown in catalog or on outline drawing. All cuts are to be clean and square. Do not nick center conductor when cutting. If using strain relief or heat shrink tubing slide onto cable first.
- Step 2:** Slide cable inside main body until cable center conductor comes out of the opposite end. Place spacer onto cable center conductor.
- Step 3:** Slide insulator onto contact if not already assembled. Insert contact assembly onto center conductor until it butts with spacer. Solder contact in place.
- Step 4:** Slide the cable assembly back into the connector's rear body until it comes to a stop. Press contact into connector using an Arbor or Arbor type press. Solder cable and main body. Slide the tubing until it yields against connector body and heat shrink it.

*RF CONNECTORS*

RFD-43F-SR2 AP.DWG

8/18/16

7610 Miramar Road, San Diego, CA 92126-4202 - (858) 549-6340  
(800) 233-1728 - Fax (858) 549-6345 E-mail: [rfi@rfindustries.com](mailto:rfi@rfindustries.com) - [www.rfindustries.com](http://www.rfindustries.com)

CZ